


A074008

Measurements recorded in: Metric Imperial

Page _____ of _____

Well Owner's Information

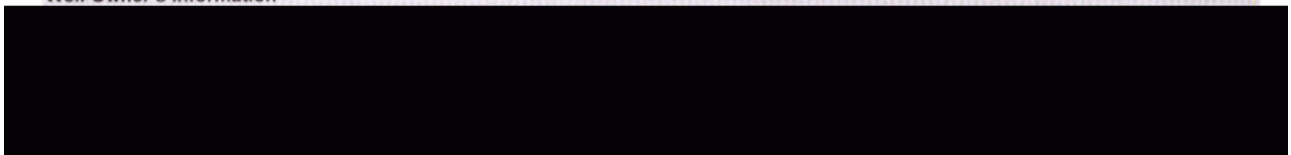

224 Island Dr. Bedford 32 6
 County/District/Municipality: Frontenac City/Town/Village: Maberly Province: Ontario Postal Code: K0H2B0
 UTM Coordinates: Zone: Easting: Northing: Municipal Plan and Sublot Number: Other:
 NAD 83 18 374732 4952074

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)

General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft)	
				From	To
Black	Earth			0	1
Red+Black	Granite			1	54.9

Annular Space

Depth Set at (m/ft) From: 0 To: 6.1
 Type of Sealant Used (Material and Type): Cement
 Volume Placed (m³/ft³): 120kg

Method of Construction

Cable Tool Diamond
 Rotary (Conventional) Jetting
 Rotary (Reverse) Driving
 Boring Digging
 Air percussion
 Other, specify

Well Use

Public Commercial Not used
 Domestic Municipal Dewatering
 Livestock Test Hole Monitoring
 Irrigation Cooling & Air Conditioning
 Industrial
 Other, specify

Construction Record - Casing

Inside Diameter (cm/in): 5.85
 Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel): steel
 Wall Thickness (cm/in): .188
 Depth (m/ft) From: 0 To: 6.1

Status of Well

Water Supply
 Replacement Well
 Test Hole
 Recharge Well
 Dewatering Well
 Observation and/or Monitoring Hole
 Alteration (Construction)
 Abandoned, Insufficient Supply
 Abandoned, Poor Water Quality
 Abandoned, other, specify
 Other, specify

Construction Record - Screen

Outside Diameter (cm/in):
 Material (Plastic, Galvanized, Steel):
 Slot No.:
 Depth (m/ft) From: To:

Water Details

Water found at Depth (m/ft) ? Kind of Water: Fresh Untested Gas Other, specify

Water found at Depth (m/ft) Kind of Water: Fresh Untested Gas Other, specify

Water found at Depth (m/ft) Kind of Water: Fresh Untested Gas Other, specify

Well Contractor and Well Technician Information

Business Name of Well Contractor: JR Thompson Well Contractor's Licence No.: 4905
 Business Address (Street Number/Name): 2076 old Brooks Rd. Municipality: Maberly
 Province: ON Postal Code: K0H2B0 Business E-mail Address:
 Bus. Telephone No. (inc. area code): 6132674800 Name of Well Technician (Last Name, First Name): Darrell Stevenson
 Well Technician's Licence No.: 2919 Signature of Technician and/or Contractor/Date Submitted: Blum Brady 20080807


Results of Well Yield Testing

After test of well yield, water was:
 Clear and sand free
 Other, specify

If pumping discontinued, give reason:

Pump intake set at (m/ft): 52
 Pumping rate (l/min / GPM): 10
 Duration of pumping: 1 hrs + min
 Final water level end of pumping (m/ft): 15.7
 If flowing give rate (l/min / GPM):
 Recommended pump depth (m/ft): 52
 Recommended pump rate (l/min / GPM): 22
 Well production (l/min / GPM): 5
 Disinfected? Yes No

Time (min)	Draw Down		Recovery	
	Water Level (m/ft)	Time (min)	Water Level (m/ft)	Time (min)
Static Level	6.8			
1	9.1	1	12.8	
2	9.1	2	11.5	
3	9.1	3	11.3	
4	9.1	4	10.9	
5	9.2	5	10.6	
10	10.0	10	9.4	
15	10.4	15	8.1	
20	10.9	20	7.3	
25	11.6	25	6.9	
30	12.3	30	6.8	
40	13.4	40	6.8	
50	14.5	50	6.8	
60	15.7	60	6.8	

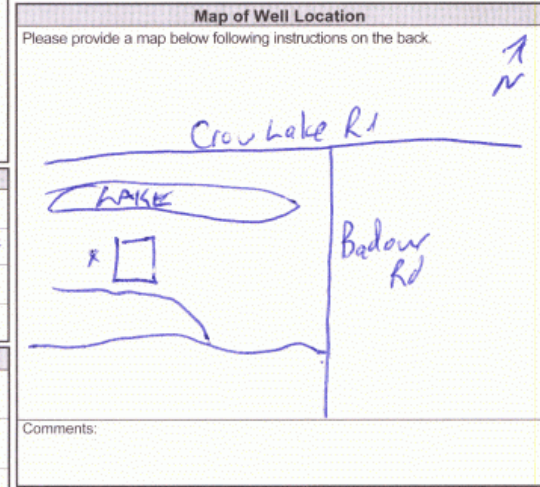

Ministry Use Only

Well owner's information package delivered: Yes No
 Date Package Delivered: 20080807
 Date Work Completed: 20080807
 Audit No.: Z 87525
 Received: SEP 15 2008