


Sewage System Maintenance Inspection

Location: 292 MARINA RD
Assessment Roll #: 08318360511050000000
Property Type: Business **Lake:** Clear Lake
System ID:

Insp. #: 26RL1301
Permit #:
Date: 09/16/2026 **Time:** 1:55 PM
Age of System:

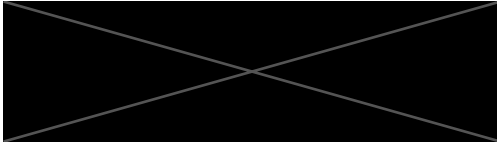

☒ Owner Present ☒ Questionnaire Returned

☒ GPS signal available during inspection

Estimated Design Flow: L/day (Floor Area: sq.ft | # of Bedrooms:)
Water Source(s): ☐ Dug Well ☒ Drilled Well ☐ Lake ☐ Imported ☐ Unknown
Pipe from Wastewater Source: No Concern
System Class(es) Onsite: ☐ Class 1 ☐ Class 2 ☐ Class 3 ☒ Class 4 ☐ Class 5

Approx. Well Location: 4,939,183 N, 396,151 E

Class 4 – Septic Tank (Type: Concrete)

Approximate UTM Location: 4,939,209 N, 396,176 E

Tank size (Length x Width x Depth):

2.7m x 1.6m x 1.2m = ~5.2m³ (5184L)

Pump Chamber: Yes

Inlet Tank Lid Opened: Yes

High Level Alarm: Recommended

Inlet Baffle: Yes

Effluent Filter: Recommended

Outlet Tank Lid Opened: Yes

Outlet Baffle: Unknown

Distance to (m):		Well: 30	Water: >30
		Line: >3	House: 5.3
Chamber	Scum (cm)	Sludge (cm)	Total (cm)
Inlet	5	15	20
Outlet	0	0	0
Total Tank Depth: 120 cm			

Distribution System (Type: Filter Media)

Approximate UTM Location: 4,939,210 N, 396,177 E

Side slopes stable: Yes

Soft spongy ground: No

Erosion concerns: No

Effluent at surface: No

Amount of cover (cm): 46

Distance to (m): Well: **>30** Water: **>30**
 Line: **>3** House: **14.3**

System Status: NO CONCERN, please use the MRSSO contact below if you have any further questions regarding your wastewater system.

Additional Comments:

Contact: MRSSO, mrssso@mvc.on.ca, phone: 613-253-0006, fax: 613-253-0122 10970 Highway 7, Carleton Place, ON K7C 3P1